

#### Sandvik HLX5D Rebuilt X048173



Make	Sandvik		Model	HLX50	) Rebuilt		
Year	Hours					As at	01/09/2018
Mileage					km	As at	
Serial/VI	erial/VIN X048173			Eng	gine Serial		
Details	Sandvik HLX5D Rebuilt.  Serial no X048173 rebuilt after scheduled change out July 2017 by RDSA.  Rebuild cost of \$12,700 + GST as per detailed rebuild report in GES equipment report Lot 0376 offered lifted on to buyers transport.  Sold via Online Auction ex Kambalda Western Australia.						
Asking pr	rice AUD	AUD Under review - call for pricing					
Ex site	Austra	a, Western A	ustralia, Kan	nbalda			

Service
history

For further details, to make an offer or book an inspection, contact Global Equipment Solutions on Office: 08 9201 1142
























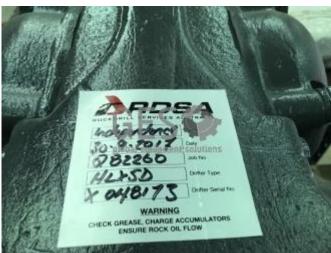







# **National Service Department**

Service Report



Please contact our *Customer Service Manager* Steven Worrall on 0439 947 918 if you have any questions.

Report authorised by Alex Sangster

Drill assessed by Ryley Giles - Kalgoorlie Service Centre



Rockdrill Services Australia Pty Ltd

ABN: 93 611 683 1780

 Melbourne 65-67 Crissane Road, Heidelberg West VIC 3081 Ph: +61 3 9455 9800 Fax: +61 3 9457 6411 Kalgoorlie
 12 Williams Street,
 Kalgoorlie WA 6430
 Ph: +61 8 9022 2386
 Fax: +61 8 9022 3009

Townsville
 27 Hugh Ryan Drive,
 Garbutt QLD 4814
 Ph: +61 7 4775 1155
 Fax: +61 7 4775 3400

**RDSA JOB #** Q82260

	RC	OCKDRILL S	ERVICE REPORT		
CUSTOMER	Independence	SITE	Long Operations	RFQ	DA0197
ROCKDRILL REMOVED	HLX5D	SERIAL#	X 048173	DATE REMOVED	-
MACHINE MODEL	-	ASSET #	J7	BOOM L/R	LH
ROCKDRILL PERCUS	SSION HRS ACHIEVED	600			
WHY WAS THE ROC					
FAULT /	PROBLEM		COMI	MENTS	
	LEAKING OIL				
	ROTATION PROBLEMS				
	PERCUSSION ISSUES				
5	SCHEDULED CHANGEOUT	Scheduled Ch	angeout		
5	OTHER (DETAILS)	No formal ch	angeout details suppli	ed	
	THIS IS SITE DAMAGE				
ROCKDRILL INSTALLED	PLEA	SERIAL#	TE DETAILS BELOW:	DATE INSTALLED	-






**Ph (1) - GH - Driver -** Replaced - Internal spline teeth worn below specifications.



**Ph (3) - FH - Seal Housing - Replaced - Seal groove wall damaged, will not hold wear strip.** 

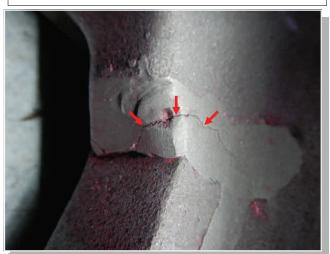


**Ph (5) - Gear Housing - Reference - Rope post bracket** cracked at weld, requires grind and weld to repair.



**Ph (2) - GH - Rotation Chuck -** Replaced - Shank contact face damaged and will not clean up within specifications.



**Ph (4) - FH - Seal Housing -** Replaced - Seal groove wall damaged, will not hold wear strip.

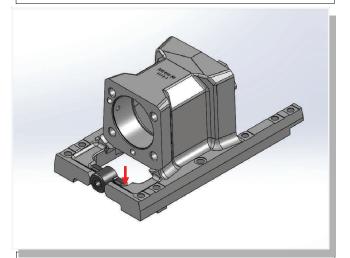

**Ph (6) - Gear Housing - Reference - Rope post bracket** cracked at weld, requires grind and weld to repair.



#### Independence (Long Operations) HLX5D Serial No. X 048173 Service Report - Build 6

This drifter arrived at our Kalgoorlie workshop on the 14 July 2017 with a Flushing Head and without a Drifter Box.

According to our records this is the sixth time this machine has been to our shop for repair.

The machine was found to be in good condition with a few significant items needing to be replaced.

#### **Service Summary**

This drifter has been stripped in accordance with *RDSA HLX5D Disassembly Procedure (Version 2)* and individual components degreased and cleaned. In accordance with this Policy, all 'single use' seals, washers and critical fasteners, nuts, washers and hydraulic fittings are to be replaced.

There is **skimming and polishing** to be carried out, the cost of which is included under **Machining** in the attached quotation.


**Note 1 - Amended Stripping & Inspection Policy** - Due to a recent premature failure of a Gear Housing shortly after leaving the workshop after overhaul, item 152 711 08 HLX GH Bushing is to be and has been removed for Gear Housing inspection purposes. Once removed they can not be refitted due to damaged caused during this process. Our policy has been amended to include the removal of these bushes every service to facilitate the proper inspection of the Gear Housing Assembly.

#### **Housing Body Condition**





 **Impact Body** - Rear Cover, HP Accumulator & Tie Rod mating faces skimmed and Main bore honed this service - Overall length, bore dimensions, bore condition and fatigue life have been considered when analysing the overall condition of the Impact Body. The current condition is 40% of overall life.



**Gear Housing** - Flushing Head mating faces skimmed, Cradle pull bolt bracket welded & machined and Bearing Assembly OS2 Modification conducted this service - Overall length, bore dimensions, bore condition and fatigue life have been considered when analysing the overall condition of the Gear Housing. The current condition is 50% of overall life.


#### Other

Items illustrated and being referred to by an arrow have been replaced by way of normal servicing; a "Green Arrow" representing items from the seal kit, an "Orange Arrow" representing items from the hydraulic fitting kit, a "Purple Arrow" representing items from the fastener kit, a "Blue Arrow" representing items from the bearing kit and a "Gray Arrow" representing standard replacement items. Items referred to by a "Red Arrow & Bubble" out of necessity. Items which require machining are referred to with a "Black Arrow & Bubble".


NWM stands for the part were Not With the Machine when it arrived at the workshop.



### **Impact Body Machining and Significant Items Replaced**

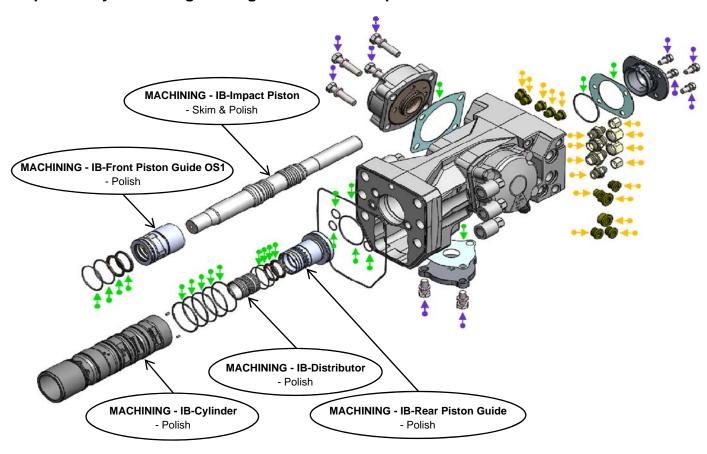


### **Impact Body Machining Required**

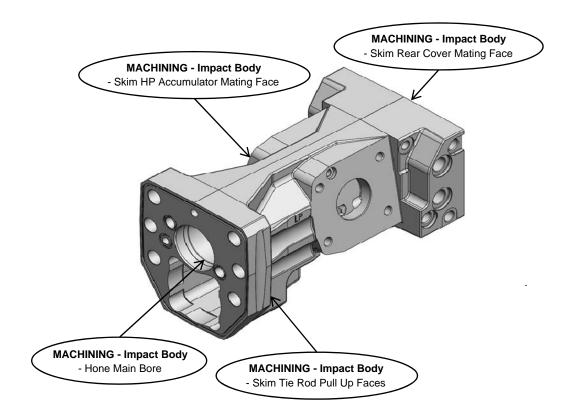




#### **Gear Housing Machining and Significant Items Replaced**

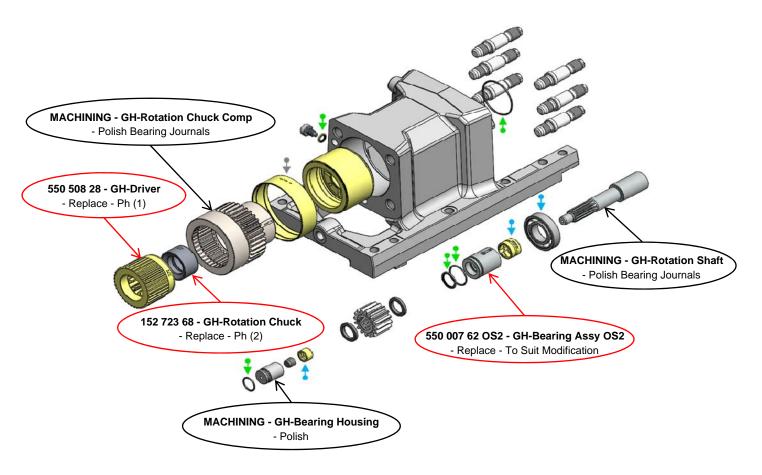


## **Gear Housing Machining Required**

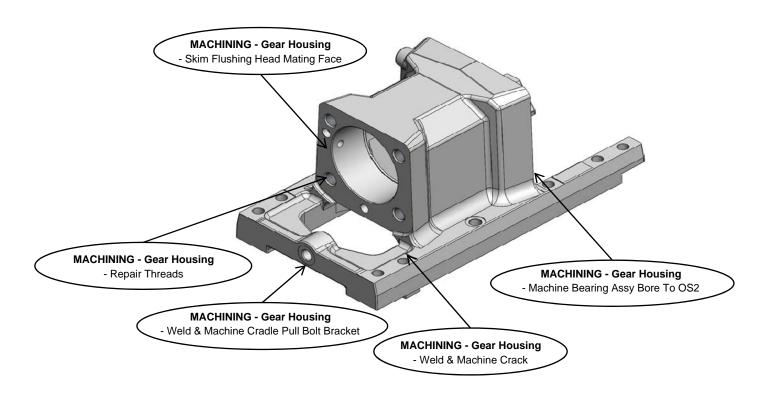




## Flushing Head Machining and Significant Items Replaced

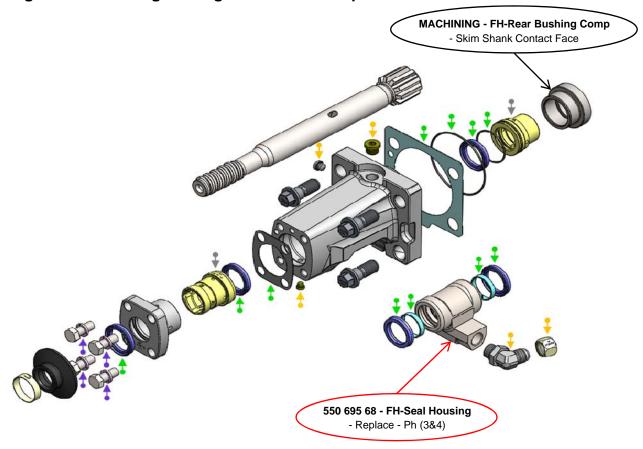

# Flushing Head Machining Required

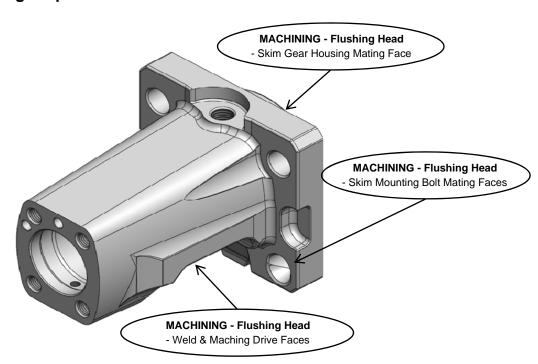





## **Accumulator Machining and Significant Items Replaced**

**High Pressure Accumulator** 

**Low Pressure Accumulator** 

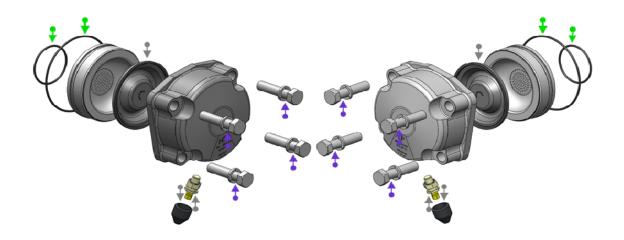

# **Hydraulic Motor Significant Items Replaced**

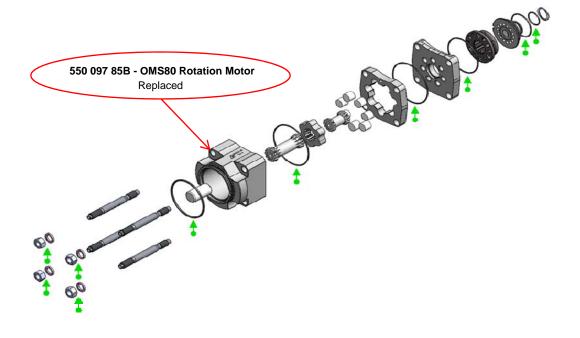

# Rockdrill Services Australia Pty Ltd

ATF The Rockdrill Services Unit Trust A.B.N. 93 611 683 180

#### 65-67 Crissane Road

# West Heidelberg

Bill To:

**Deliver To:** 

Victoria 3081

Telephone: 61 (08) 9022 2386 Facsimile: 61 (08) 9022 3009



**TAX INVOICE** 



Invoice No.

82260

Date:

14/07/2017

Your Order No:

DRIFTER REBUILD

Ship Method:

Road Freight

Service Person:

Ryley Giles

Terms:

Net 30 After EOM

Page:

Long Shart
Durkin Road
KAMBALDA, WA, 6444

P O Box 496

L - - - Ob - 44

**Independence Long Pty Ltd** 

Independence Long Pty Ltd

**SOUTH PERTH WA 6951 Australia** 

Qty	Item No.	Description	Price	Disc%	Amount
1	LABOUR	Labour	\$1,456.00		\$1,456.00
1	SUNDRY	Oil / Environment / Test	\$192.27		\$192.27
1	MACHINING	Machining	\$2,864.12		\$2,864.12
1	7372 1392 01	HLX5D-GI SEAL KIT	\$544.76		\$544.76
1	7372 1043 01	HLX-FH SEAL KIT	\$89.47		\$89.47
1	7372 1343 01	HLX5D/T DRILL FASTENER KIT	\$78.47		\$78.47
1	7372 1347 01	HLX5D HYD FITTING KIT	\$563.83		\$563.83
1	7372 1348 01	HLX5D BEARING KIT	\$258.20		\$258.20
1	152 711 08	HLX-GH-BUSHING	\$289.52		\$289.52
1	550 036 03	HLX-GH-SCREW	\$45.31		\$45.31
1	152 697 08	HLX-FH-REAR BUSHING	\$261.09		\$261.09
1	152 744 08	HLX-FH-FRONT BUSHING	\$215.00		\$215.00
2	092 602 98	AC-DIAPHRAGM 119.5	\$27.60		\$55.20
2	7372 1003 01	CHARGE VALVE COMP	\$19.43		\$38.86
2	085 370 18	CHARGE VALVE RUBBER CAP	\$1.87		\$3.74
4	152 525 68	HLX-DOME NUT	\$87.25		\$349.00
1	550 508 28	HLX-GH-DRIVER	\$1,128.48		\$1,128.48
1	550 007 62 OS2	HLX-GH-BEARING ASSY OS2	\$705.31		\$705.31
1	152 723 68	HLX5D-GH-CHUCK	\$675.87		\$675.87
6	152 716 38	HLX-GH-STUD	\$191.52		\$1,149.12
4	7372 0623 01	INSERT FREE M24x3x1.5D	\$9.18		\$36.72
1	550 695 68	FH-SEAL HOUSING 45	\$573.36		\$573.36

HLX5D - X 048173 - RFQ:	Sale Amount:	\$12,741.05
TIENOS NOTOTIC TRI Q.	GST:	\$1,274.11
	Total inc GST:	\$14,015.16
	Paid:	\$0.00
Subject to the Terms & Conditions of Trading Per our website www.rockdrillservices.com	Balance Due:	\$14,015.16

How to Pay Remittance Advice



<u>Mail</u>

Please make cheques payable to:

Rockdrill Services Australia Pty Ltd

Post cheques to

65-67 Crissane Road West Heidelberg Vic 3081



**Direct Credit** 

Name: Rockdrill Services Australia Pty Ltd

BSB: **036 125** Account: **230 293** 

Invoice No: **82260** Amount Due: **\$14,015.16** 

# Rockdrill Services Australia Pty Ltd

ATF The Rockdrill Services Unit Trust A.B.N. 93 611 683 180

#### 65-67 Crissane Road

# West Heidelberg

**Victoria 3081**Telephone: 61 (08) 9022 2386

Telephone: 61 (08) 9022 2386 Facsimile: 61 (08) 9022 3009



### **TAX INVOICE**



Invoice No. 82260

Date: 14/07/2017

Your Order No: DRIFTER REBUILD

Ship Method: Road Freight

Service Person: Ryley Giles

Terms: Net 30 After EOM

Page:

Bill To:	Independence Long Pty Ltd

P O Box 496

**SOUTH PERTH WA 6951 Australia** 

Deliver To: Independence Long Pty Ltd

Long Shaft Durkin Road

KAMBALDA, WA, 6444

Qty	Item No.	Description	Price	Disc%	Amount
4	550 034 00	FH-BOLT	\$39.78		\$159.12
1	7372 1430 01	SHANK BLANK 45	\$25.00		\$25.00
1	550 097 85B	HLX/RD5 OMS80 MOTOR Refurb	\$983.23		\$983.23

HLX5D - X 048173 - RFQ:	Sale Amount:	\$12,741.05
HEAD ACTORIO IN Q.	GST:	\$1,274.11
	Total inc GST:	\$14,015.16
	Paid:	\$0.00
Subject to the Terms & Conditions of Trading Per our website www.rockdrillservices.com	Balance Due:	\$14,015.16

How to Pay Remittance Advice



<u>Mail</u>

Please make cheques payable to:

Rockdrill Services Australia Pty Ltd

Post cheques to

65-67 Crissane Road West Heidelberg Vic 3081



**Direct Credit** 

Name: Rockdrill Services Australia Pty Ltd

BSB: **036 125** Account: **230 293** 

Invoice No: **82260** Amount Due: **\$14,015.16**